

SERVICE BULLETIN

Classification:	Reference:	Date:	
BF91-010	NTB91-047	May 9, 1991	

DOOR WINDOW NOISE


APPLIED VEHICLE(S): 1991 300ZX

SERVICE INFORMATION

On some 1991 300ZX vehicles, a creaking/popping noise may be heard from the right or left door window. This noise occurs while the vehicle is being driven with the window partially or completely closed. To eliminate this noise, lubricate the window guide pins using the following service procedure.


SERVICE PROCEDURE


- 1. Fully lower the incident door window.
- 2. Remove the door lower panel, upper seat belt assembly and door inner panel.
- 3. Remove the door window glass from the regulator.
- 4. Manually raise and lower the window glass in the guide rails to check that it moves without binding. If binding occurs, adjust the guide rails until it is eliminated (Refer to Technical Bulletin BF89-032/TS89-149, "300ZX Door Window Checks/Adjustments").
- 5. Remove the window glass from the door guide rails.
- 6. Carefully pry off the wheel caps from pins A, B and C using a sharp scribe, dental pick or equivalent. See illustration below.

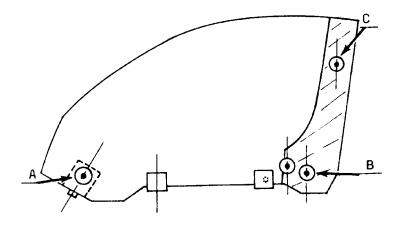



7. Lubricate the inside hole in the wheel and around the end of the pins as indicated in the illustrations below.

NOTE: Use a multi-purpose grease (such as ball joint grease or grease with a higher viscosity). Do not use aerosol grease/lubricants (such as spray white lithium grease), since these greases do not provide sufficient durability.

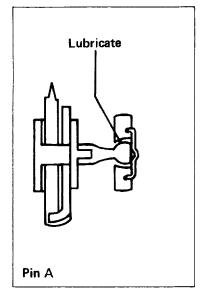

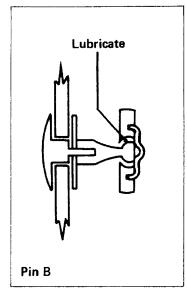

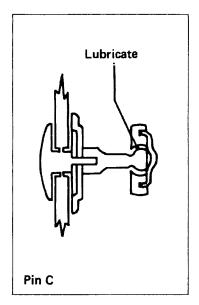

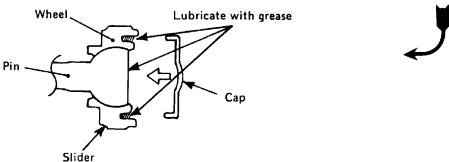

8. Replace the caps and re-install the glass in the door guide rails. Be certain to sufficiently grease the entire length of all three rails.

NOTE: Be careful not to allow excessive grease on the window glass.

9. Reassemble the previously removed door components, then check the door window for smooth operation.

CLAIMS INFORMATION

OPERATION	OP CODE	PNC	CS	СТ	FRT
Rpl. one door glass	UH22AA	80311	4R	31	1.3